## **DA Gauge**


## **Disappearing Gauge**

Gauge

**DABT** 





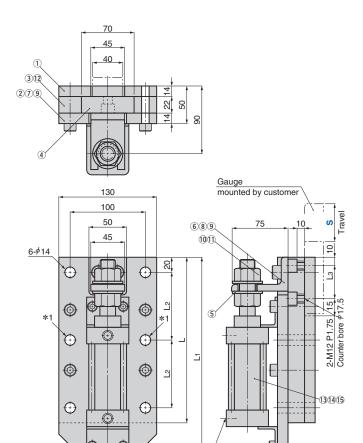

\*1 This bolt hole is not available for DABT50.

No.	Description	Qty	Material and Remark
1	Base Plate	1	Steel
2	Cover Plate	1	Steel
3	Side Plate	2	Steel
4	Slide Plate	1	SO#50S45C
5	Collar	1	Steel
6	Arm	1	Steel
7	Hexagon Socket Head Bolt	4	M10x50
8	Hexagon Socket Head Bolt	2	M12x25

ı	No.	Description	Qty	Material and Remark
	9	Spring Washer	4	M10
	10	Washer	2	_
	11	Lock Nut	1	U nut
	12	Dowel	4	∮10x30
	13	Spring Pin	1	∮ 6x15
	14	Hexagon Socket Head Bolt	4	M8x16
	15	Air Cylinder	1	SMC (\$\phi\$40)

Catalog No.	S	L	L <sub>1</sub>	L2	L <sub>3</sub>	Weight kg
	50	220	265	90	25	13.5
DABT	100	270	315	115	45	15.9
	150	320	365	140	95	18.3



Catalog No.	S	
DABT	150	

## **■**When Using Product

- · Use DA gauge "DABT" as the panel locator for a draw die.
- · Sliding areas have lubricant for oilless operation.
- The bolt holes of the sliding plate (④) are threaded so that the gauge may be mounted from the gauge side. (Dimension L<sub>3</sub>)