



SOXB

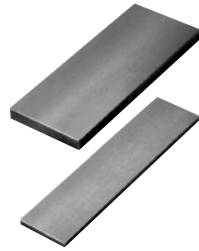

● Sliding Direction

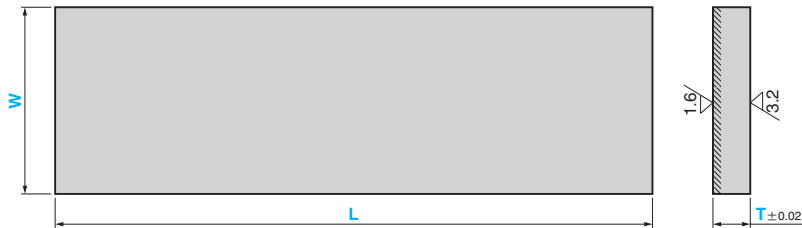

Material : Copper powder sintered (#200)
 Hatched Area Sintered
 Thickness 1.2 mm or more
 T=10 S45C(base plate)
 T≥20 SS400(base plate)

● For Operation:


- Cut or drill the plate as required.
- When the thickness is adjusted, machine the back surface.
- Apply grease for initial lubrication before operation.

Catalog No.	W	L	T
	75		
	100		10
	125		
SOXB	150	320	
	75		
	100		20
	125		
	150		
	100	320	25


Order - - -

■ Recommended Bolt


For M6
T=5

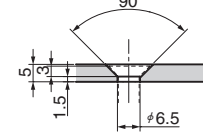


For M8
T=5

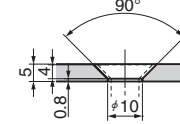


For M8
T=10

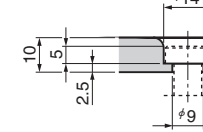


T = 20-25

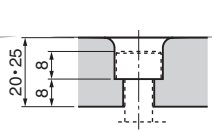

For M10
T=10

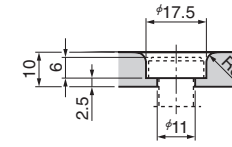

T = 20-25

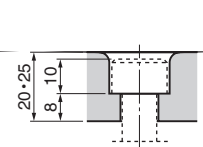

■ Chamfer specification SOX, SOXT

