


DABT

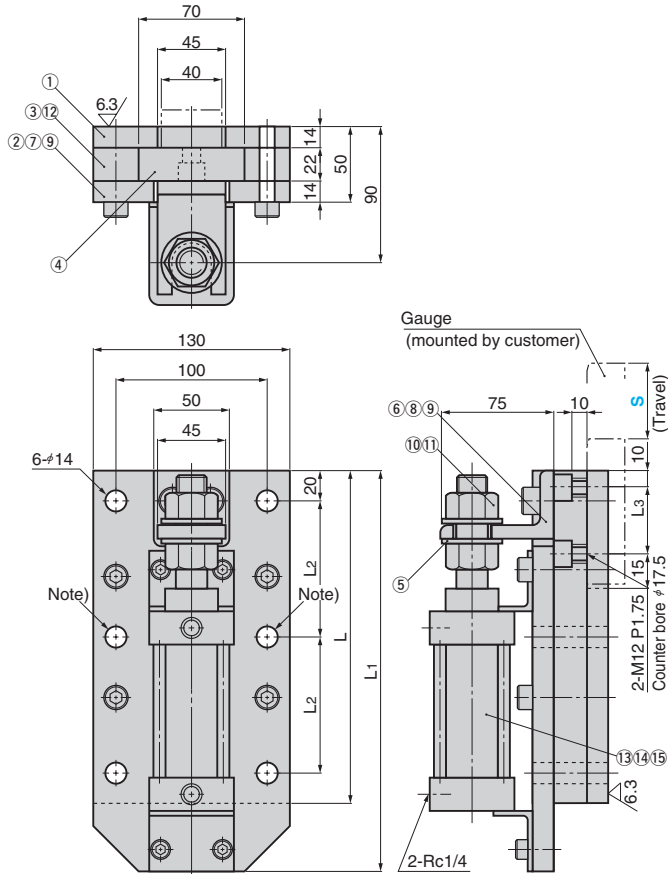

Note) This bolt hole is not available for DABT50.

Table of Components

No.	Description	Qty	Material and Remark	No.	Description	Qty	Material and Remark
①	Base Plate	1	SS400	⑨	Spring Washer	4	For M10
②	Cover Plate	1	SS400	⑩	Washer	2	
③	Side Plate	2	SS400	⑪	Lock Nut	1	U nut
④	Slide Plate	1	S45C Oilless Type	⑫	Dowel Pn	4	#10×30
⑤	Collar	1	SS400	⑬	Spring Pin	1	#6×15
⑥	Arm	1	SS400	⑭	Hexagon Socket Head Bolt	4	SCM435 M8×16
⑦	Hexagon Socket Head Bolt	4	SCM435 M10×50	⑮	Air Cylinder	1	D-MCY-F40 by Taiyo
⑧	Hexagon Socket Head Bolt	2	SCM435 M12×25				

L	L <sub>1</sub>	L <sub>2</sub>	L <sub>3</sub>	Weight(kg)	Catalog No.	S
220	265	90	25	13.5	<b>DABT</b>	<b>50</b>
270	315	115	45	15.9		<b>100</b>
320	365	140	95	18.3		<b>150</b>
370	415	165	145	21.0		<b>200</b>



Order

Catalog No.

S



S = 200 is made to order.

**DABT**

**150**

For Operation

- Use DA gauge "DABT" as the panel locator for a draw die.
- Sliding areas have lubricant for oilless operation.
- The bolt holes of the sliding plate (④) are threaded so that the gauge may be mounted from the gauge side. (Dimension L<sub>3</sub>)